


HA1232-66 - CENTERING GUIDE 3K-
6K LIFTS WITH STEEL CRADLE-
2020/7/23 - CURRENT

TABLE OF CONTENTS

HA1232 - CENTERING GUIDE FOR 3-6K WITH STEEL CRADLE - current	3
---	---

HA1232 - CENTERING GUIDE FOR 3-6K WITH STEEL CRADLE - current

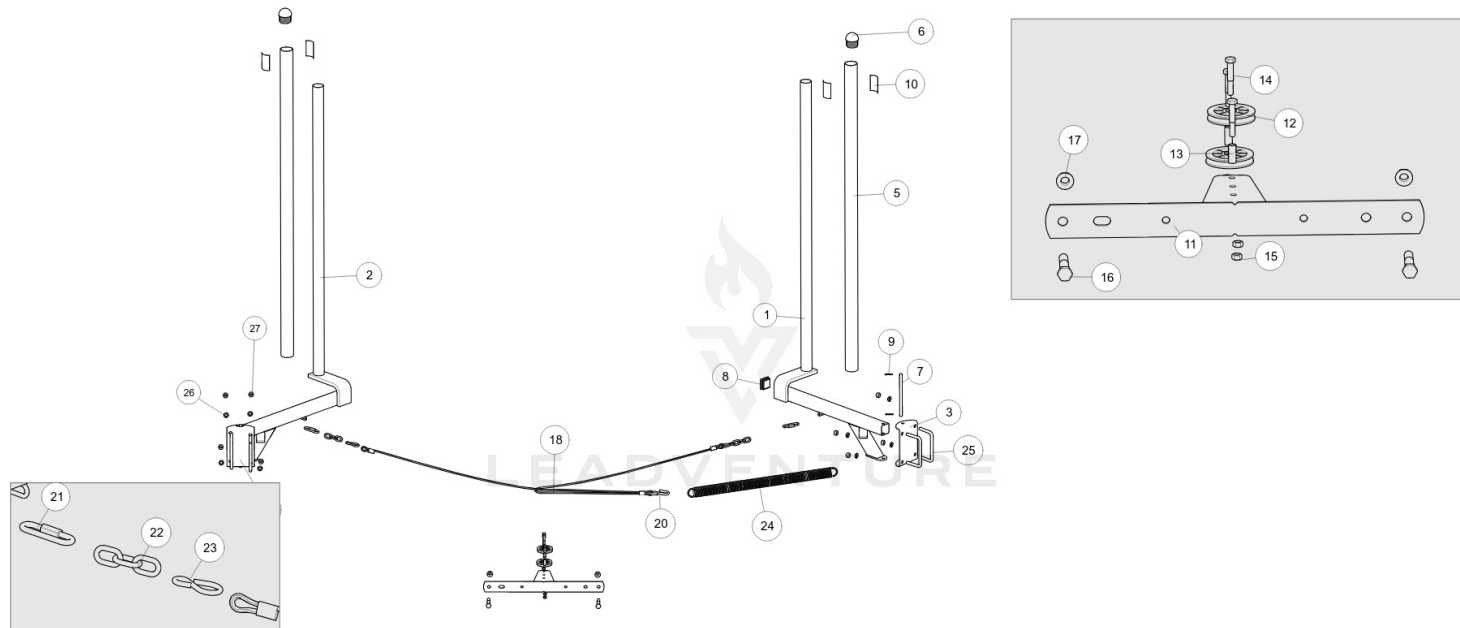

Rendered by LeadVenture, Inc.

HA1232 - CENTERING GUIDE FOR 3-6K WITH STEEL CRADLE - current

Ref Number	Part Number	Part Description	Context Notes	Quantity
1	67807	HCD POST WMENT RIGHT		1
2	67808	HCD POST WMENT LEFT		1
3	6780900	HCD SWING BRKT RIGHT WMENT		1
4	6779900	HCD SWING BRKT LEFT		1
5	3510206	POLY TUBE 2 5/16 IN OD DOCK BUMPER WHITE 60 INCH		2
6	3510205	CAP DOCK BUMPER WHITE		2
7	67804	PIN 1/2 DIA X 8 5/16		2
8	3510394	CAP BLK PLASTIC 2IN .08 TO 10GA INTERNAL SQR-2-10-14		2
9	1540035	COTTER KEY 1/8 X 1		4
10	4811422	DECAL CAUTION PINCH POINT		4
11	67810	HCD PULLEY BRKT WMENT		1
12	3510172	PULLEY POLY 2 1/2IN		2
13	67805	BUSHING 7/16 OD		2
14	0110029	HH 5/16-18 X 2 CS GR5		3
15	1410079	HEX LOCKNUT 5/16-18 GRA		3
16	0110107	HH 1/2-13 X 3 CS GR5		2
17	1440102	HEX LOCKNUT FLANGE 1/2-13 W/T&T		2
18	67811	HCD CABLE ASSEMBLY		1
19	3110376	CABLE TENSION ASSY 5/32 SS HCD		1
20	1920012	S HOOK 3/8 DIAMETER #835		1
21	1920013	QUICK LINK 1/4 (7MM) PLATED		2
22	2220268	CHAIN 1/4 (7MM) PC X 3 LINK ZP		2
23	1940010	S HOOK 532 ZP		2
24	2121229	SPRING .207 WIRE SS HCD		1
25	0310395	SUB 1/2-13 X 5 9/16 X 3		4
26	1310040	LOCKWASHER 1/2 S/T MED		8
27	1440159	HEX NUT 1/2-13		8